



Field Bulletin

- STS PPM Application update
- STS V3.0 and earlier

Bulletin #:	F00605
Bulletin Date:	August 22, 2005
Subject:	PPM Application update
Affected Model(s)	STS V3.0 and earlier.

Summary:

An update to STS V3.0 and earlier can be made to address the problem of loading a configuration file and a .bin file onto a PPM and having the incorrect LED pattern displayed on the PPM.


Details:

When downloading a configuration file into a SCXX acceptor head via a PPM that contains a .bin file and a configuration setting, the PPM will give a continuously flashing Red LED and a solid Green LED after a successful download is complete. This LED pattern represents a communication problem and shouldn't be displayed after a successful download. The Green and Red LEDs should both be illuminated during the download and turn off after a successful download is complete.

Action:

To fix this problem an application program update must be applied to the PPM. To do this, follow the procedure below.

- Locate the STS folder on your hard drive and place the application software update in the handheld folder. (See example below)

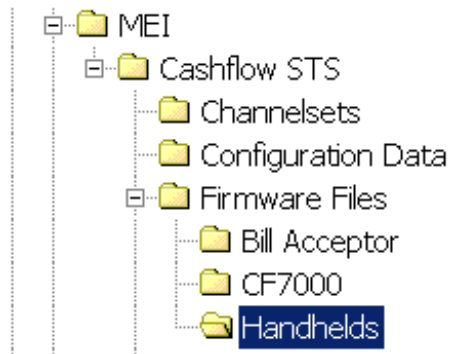

Contact your local MEI representative about obtaining the application software file update.